

Port of Varanus Island – Blockage of Seawater Strainers

Number: V08/2024

Date: 18/12/2024

Date of Effect:	18/12/2024
Details:	Port of Varanus Island – Blockage of seawater strainers
Former Notice:	Nil
Charts & Publications:	AUS 65
Further Notice:	Nil
Attachments:	Varanus Island Chartlets

Mariners are advised that there is an upward trend of cooling related main engine slowdowns due to blockage of seawater strainers. Currently a mass spawning of crustaceans gathering under ships in the Western Anchorages being drawn into ships cooling water intakes.


Masters are advised to ensure that their seawater strainers are inspected and cleared before commencing an inbound pilotage.



All current local Marine Notices are available on our website: <http://www.pilbaraports.com.au/#marine-notices>

Phone: (08) 9159 6556 | dampier.vts@pilbaraports.com.au

Mariners and other port users are requested to notify the Harbour Master on the discovery of new dangers or suspected dangers to navigation within the Port.

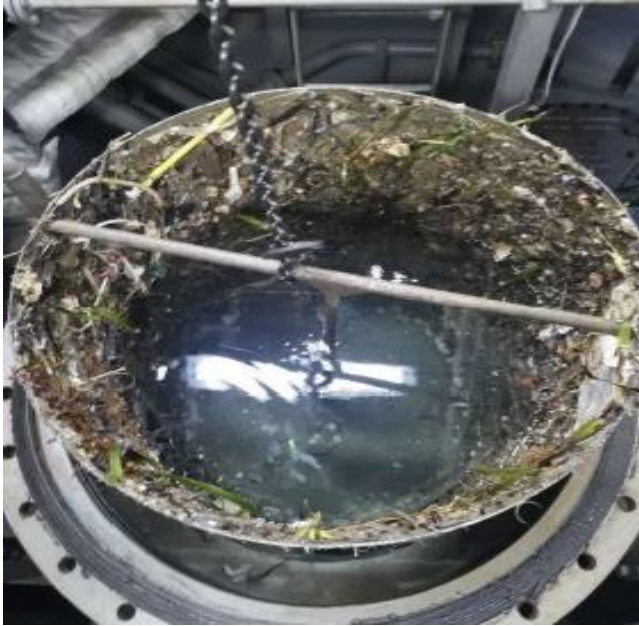

Recommendations and best practices:

- Detailed procedure for cleaning seawater strainers including back flushing, changing and cleaning is provided.
- Spare filters, all tools and equipment for opening the sea chest and cleaning is readily available.
- All Engineering staff is familiar with contingency plans.
- Monitor pressure at pumps and filters during the pilotage and respond without delay.

Mike Minogue



Harbour Master West
Pilbara Ports

All current local Marine Notices are available on our website: <http://www.pilbaraports.com.au/#marine-notice>

Phone: (08) 9159 6556 | dampier.vts@pilbaraports.com.au

Mariners and other port users are requested to notify the Harbour Master on the discovery of new dangers or suspected dangers to navigation within the Port.